

Office of Environmental Management – Grand Junction



Moab UMTRA Project
Flood Mitigation Plan

Revision 5

April 2016



U.S. Department
of Energy

Office of Environmental Management

**Moab UMTRA Project
Flood Mitigation Plan**


Revision 5


April 2016

Moab UMTRA Project Flood Mitigation Plan

Revision 4

Review and Approval

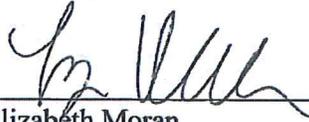
Elizabeth Moran
TAC Project Hydrogeologist
04/27/16
Date

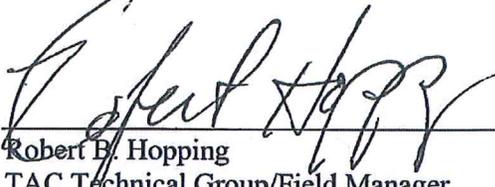
Robert B. Hopping
TAC Technical Group/Field Manager
4/27/16
Date


Craig Niemeyer
RAC Moab Operations/Site Manager
27 APR 16
Date


Jeffrey C. Biagini
RAC Project Manager
4-27-2016
Date


Joseph D. Ritchey
TAC Senior Program Manager
4/29/16
Date

Reviewed by:


Donald R. Metzler
Moab Federal Project Director
5-2-2016
Date

Revision History

Revision Number	Date	Reason for Revision
0	May 2008	Initial issue.
1	May 2011	Annual update.
2	May 2013	Annual update.
3	May 2014	Annual update includes incorporation of new ground water and surface water data.
4	July 2015	Annual update.
5	April 2016	Revision includes clarification of specific actions in Sections 3.1 and 3.2.

Contents

Section	Page
Acronyms and Abbreviations	iv
1.0 Introduction.....	1
1.1 Purpose and Scope	1
1.2 Background.....	2
1.3 Site Condition	2
2.0 Monitoring Colorado River Stage.....	5
2.1 Flood Designations	5
2.2 River Stage Reporting.....	6
3.0 Decision-making for Mitigating Potential Flood Damage.....	6
3.1 Specific Actions at 15,000 cfs	8
3.2 Specific Actions at 25,000 to 30,000 cfs	8
3.3 Specific Actions at 35,000 cfs or Greater	9
3.4 Specific Actions for Moab Wash during Heavy Precipitation Events.....	9
4.0 Specific Actions for Flood Mitigation	9
5.0 Specific Actions after Flood Water Recedes.....	10
6.0 References.....	10

Figures

Figure 1. Moab Site Features	3
Figure 2. Moab Site Features, Colorado River Elevations and 2011 Flood Extent, and Contamination Area Berms and Elevations.....	4
Figure 3. Cisco River Gage vs. Site Elevation Gage.....	5
Figure 4. Example Hydrograph From Cisco, Utah, Gaging Station	7

Table

Table 1. Key River Flows, River Surface Elevations, and Associated Areas Impacted.....	7
--	---

Appendix

Appendix A. Surface Water Elevation vs. Site Elevation	A-1
--	-----

Attachment

Attachment 1. Berm Inspection Form and Checklist	
--	--

Acronyms and Abbreviations

CF	Configuration
cfs	cubic feet per second
DOE	U.S. Department of Energy
ft	feet
IA	interim action
msl	mean sea level
NOAA	National Oceanic and Atmospheric Administration
NWS	National Weather Service
POD	Plan of the Day
RAC	Remedial Action Contractor
TAC	Technical Assistance Contractor
UMTRA	Uranium Mill Tailings Remedial Action
USGS	U.S. Geological Survey
VFD	variable frequency drive

1.0 Introduction

The U.S. Department of Energy (DOE) Moab Uranium Mill Tailings Remedial Action (UMTRA) Project site (Moab site) is a former uranium ore-processing facility located about three miles northwest of the city of Moab in Grand County, Utah, and lies on the western bank of the Colorado River at the confluence with the Moab Wash.

Several features of the Moab site are shown in Figure 1. The site is transected by the Moab Wash, which flows during significant storm events. North of the wash is a freshwater intake structure that supplies a pond used for irrigation, dust control, and injection water as part of ground water interim action (IA) remediation.

The IA well field is located between the toe of the tailings pile and the river south of the Moab Wash. The site is susceptible to flooding because about 160 acres of the nearly 480 acres of the property are within the 100-year floodplain of either the Colorado River or the Moab Wash.

A berm located along the Colorado River north of the Moab Wash berm and several off-pile areas of the site have been remediated. A 20-acre area north of the Moab Wash (northern off-pile area) was remediated in the winter of 2010/2011 by excavating and removing the contaminated soil. As part of this remediation, the berm that was installed along the riverbank by the previous site owner was removed. In addition, more than 158,000 cubic yards of contaminated soil were removed from this area during the remediation, creating areas of lower elevation. As was anticipated, this northern off-pile area is now more susceptible to flooding at lower river stages.

Section 2.0 of this Plan provides information about river stage and flood predictions. Section 3.0 presents the trigger points that mandate specific actions, Section 4.0 provides guidance on specific steps in flood preparation, and Section 5.0 provides guidance to the steps that should be taken after the flood water has receded.

1.1 Purpose and Scope

This Plan is intended to minimize adverse impacts on DOE-owned or -managed property associated with the Moab Project from river flooding.

This Plan is applicable to flooding that may occur at or near the Moab site and outlines the planning and actions to be taken by the Technical Assistance Contractor (TAC) and Remedial Action Contractor (RAC) in preparation for possible flood conditions. In the event of flooding, the *Moab UMTRA Project Emergency/Incident Response Plan* (DOE-EM/GJ1520) will be utilized. The *Emergency/Incident Response Plan* contains a Flood Action Plan checklist that includes actions to be taken (e.g., notifications, evaluations) when the RAC Operations/Site Manager calls a Flood Alert.

1.2 Background

Stream flow on the Colorado River has been collected by the U. S. Geological Survey (USGS) at gaging station 09180500 near Cisco, Utah, since 1914. This station, located approximately 35 miles upstream of the site, is the closest station to Moab and provides the most complete data set representing river flow passing the site. There are no significant tributaries between the gaging station and the Moab site. In 2009, the Project installed a standard USGS-style river staff gage at the freshwater intake structure, just west of the freshwater pond at the eastern (upstream) end of the site. The elevation of the Colorado River surface is recorded from the gage on a routine basis.

On average, the river reaches a maximum flow between late May and early June, with an average annual instantaneous peak runoff at the Cisco gage of 27,500 cubic feet (ft) per second (cfs). Above-average runoff is attributed to a combination of above-average snowpack in the Upper Colorado River Basin, late spring precipitation events, and above-average temperatures. Peak flows within the last 50 years reached more than 40,000 cfs 12 times, with the two highest peak flows occurring in 1983 and 1984 (61,900 and 70,300 cfs, respectively).

During the springs of 1983 and 1984, the Moab site was reportedly flooded up to the toe of the tailings pile. The most significant recent site flooding event occurred in 2011 (Figure 2), when the peak runoff reached 48,600 cfs, which is equivalent to a river surface elevation of 3,967.2 ft mean sea level (msl) on June 9, and the river flow remained above the average annual peak flow from late May through mid-July. The impacts of this flooding event are well documented in the *Moab UMTRA Project 2011 Flood Response Summary* (DOE-EM/GJTAC2007).

1.3 Site Condition

Figure 3 represents a rating curve generated using the 2011 flows for the site based on the river flows measured at the Cisco gaging station and the corresponding river surface elevation measured at the site river intake structure.

Ground surface elevation shows a low point on the riverbank south of the freshwater pond with an elevation of 3,957 ft msl (Figure 2). Using the rating curve, the associated river surface elevation for flows above 11,000 cfs will exceed the land surface elevation at this location, allowing river water to begin to migrate into the area. Once flows exceed approximately 33,000 cfs, the low point on the berm along the Moab Wash will be topped, and river water is expected to flow to the south within the constructed channel that runs through Configuration (CF) 5 from the Moab Wash.

The bank along the river from the Moab Wash down to the southern end of CF4 has elevations that generally range from 3,968 to 3,969 ft msl; however, the survey identified a low spot on the berm adjacent to the area between the infiltration trench and the baseline area, where the elevation is 3,967.2 ft msl. River flows above 48,000 cfs would allow the river to flow into the well field.

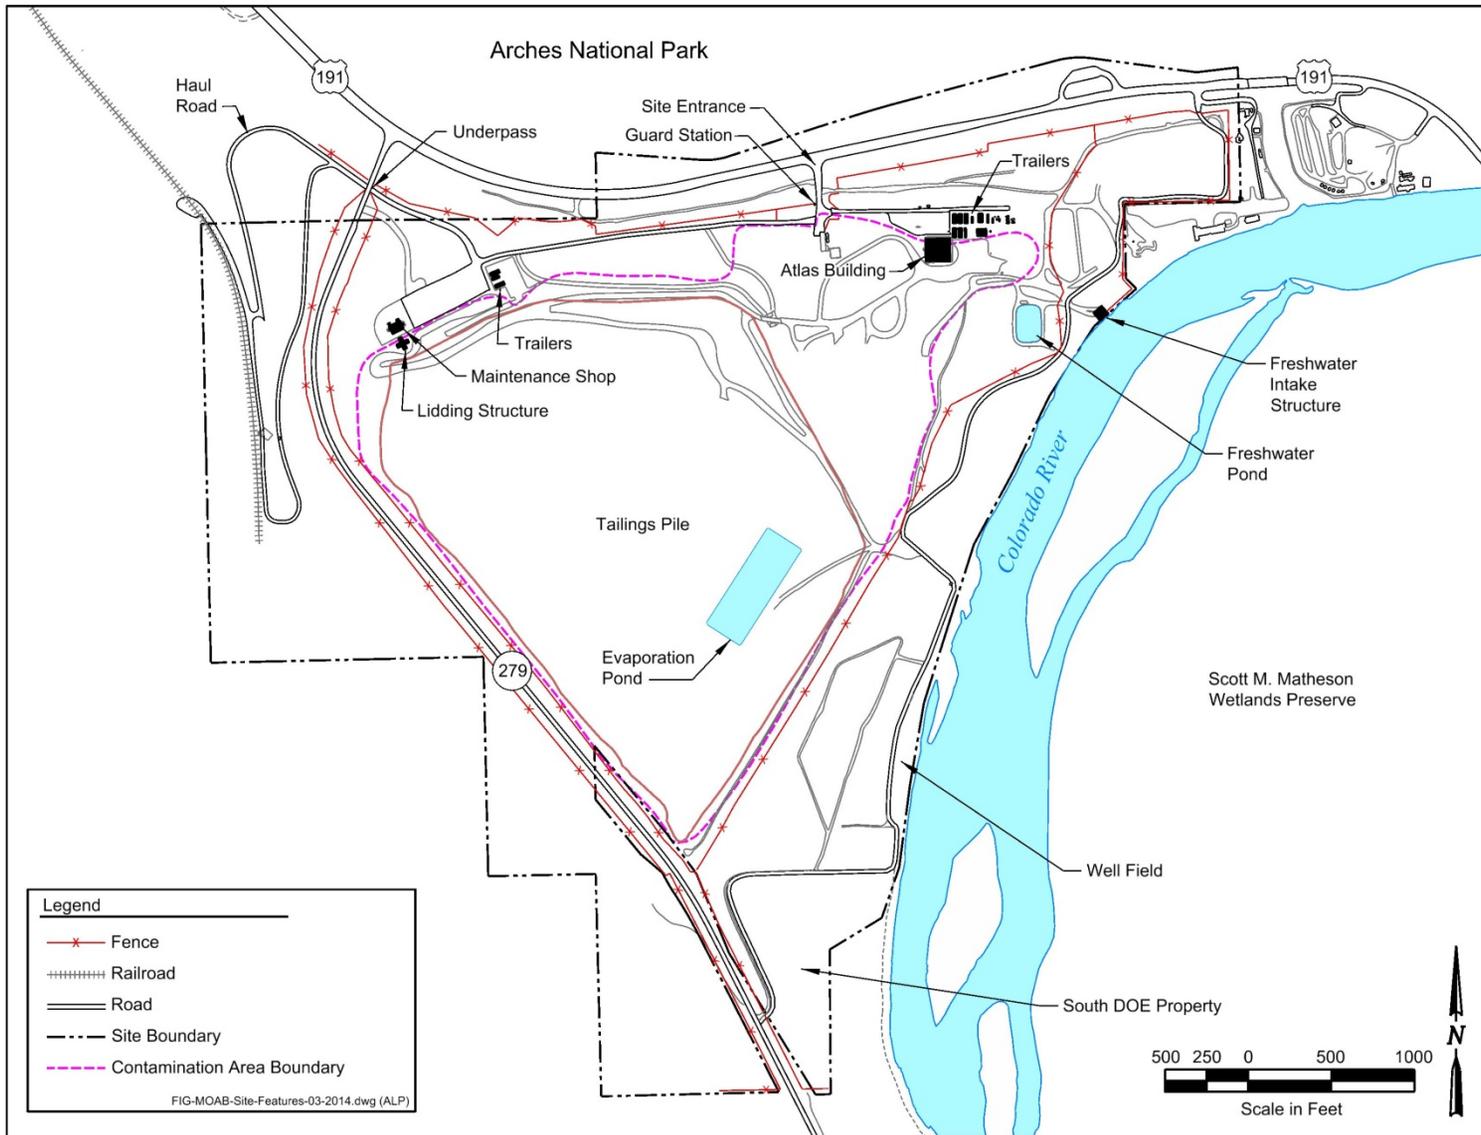


Figure 1. Moab Site Features

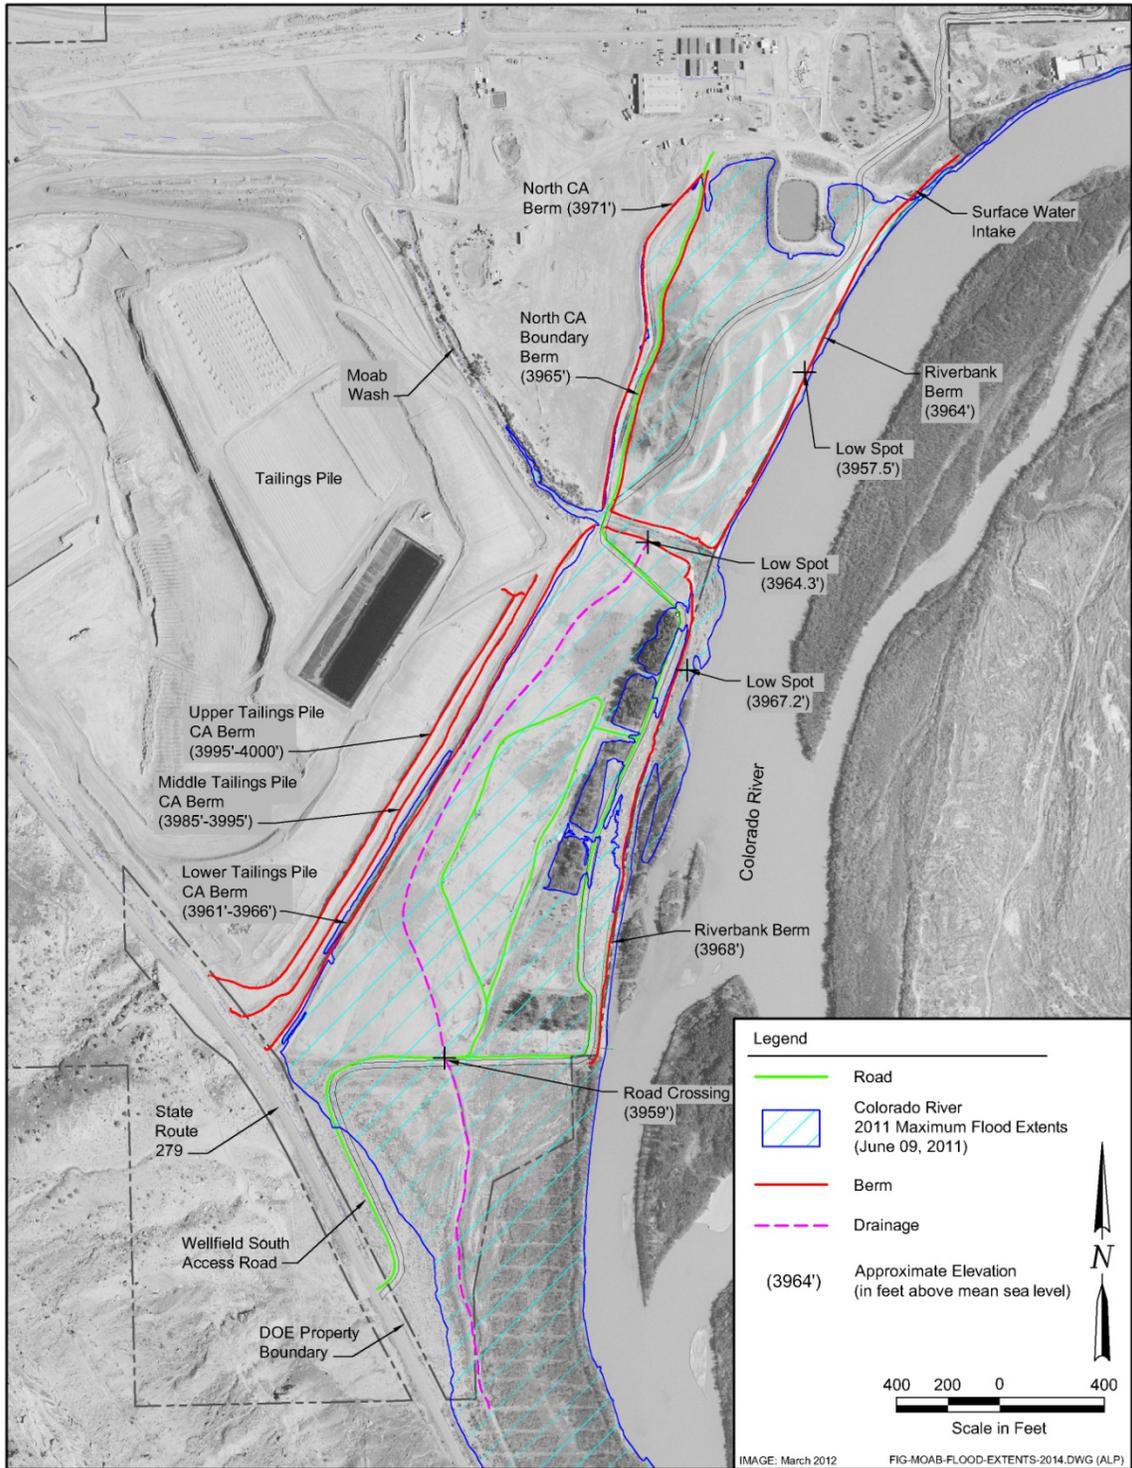


Figure 2. Moab Site Features, Colorado River Elevations and 2011 Flood Extent, and Contamination Area Berms and Elevations

Flow rates exceeding 60,000 cfs at the Cisco gage could potentially reach the toe of the tailings pile. Due to the wide girth of the river at Moab, even if inundated, there is insufficient energy in the river to adversely impact the tailings pile so protection of the tailings pile from flooding is limited to maintaining the berms during lower river stages. Additional information is available in:

- Federal Emergency Management Agency, “Flood Insurance Study, Grand County, Utah,” 2006.
- U.S. Geological Survey Scientific Investigations Report 2005-5022, “Initial Phase Investigation of Multi-Dimensional Streamflow Simulations in the Colorado River, Moab Valley, Grand County, Utah,” 2004.

2.0 Monitoring Colorado River Stage

When the river flow rate at the Cisco gage is expected to exceed 15,000 cfs, the TAC monitors the current and forecast river stage daily and reports the status to the RAC in the Plan of the Day Meeting (POD).

2.1 Flood Designations

The National Weather Service (NWS) has a flood warning notification system that includes several flood designations applicable to the Moab site, including flash flood warning, flood warning, and river flood warning (<http://www.nws.noaa.gov/floodsafety/index>). The NWS reports forecast the river stage for 2 weeks.

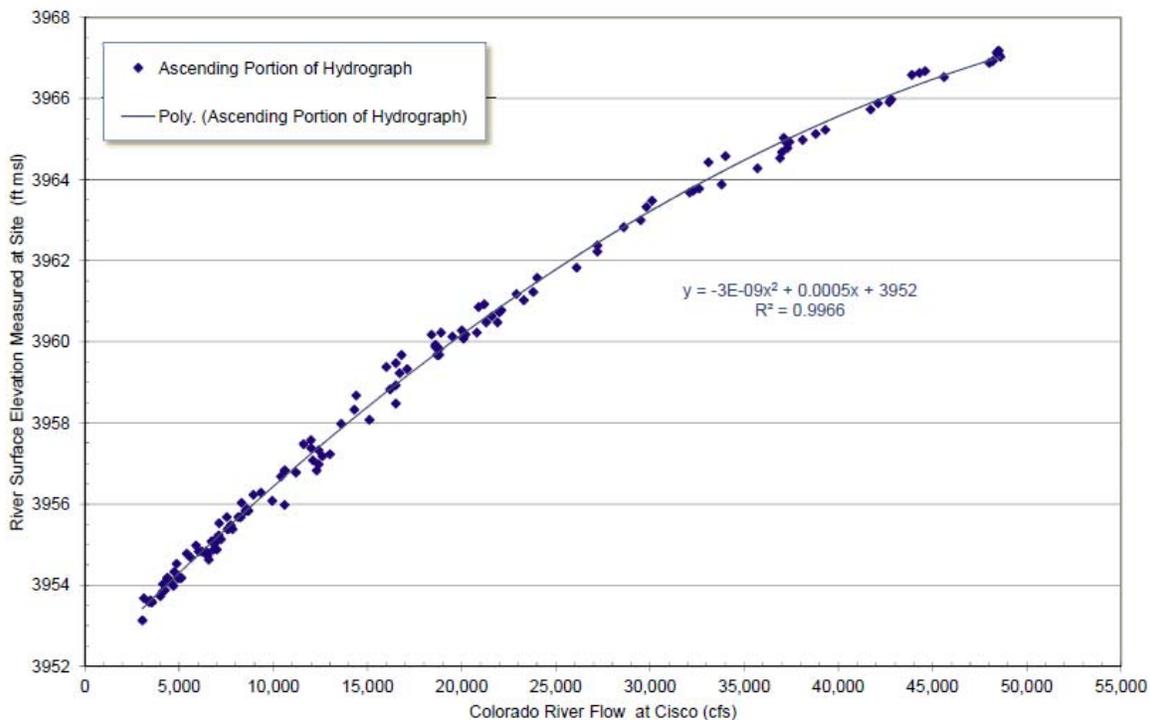


Figure 3. Cisco River Gage vs. Site Elevation Gage

Flood designations are described as follows.

Flash flood warning – Issued to inform the public, emergency management, and other cooperating agencies that flash flooding is in progress, imminent, or highly likely.

Flood warning – In hydrologic terms, a release by NWS to inform the public of flooding along larger streams that pose a serious threat to life or property. A flood warning will usually contain river stage (level) forecasts.

River flood warning – This warning is issued by the local NWS when the forecast points at specific communities that have formal gaging sites and established flood stages or areas along rivers where flooding has been forecast, is imminent, or is in progress. Flooding is defined as the inundation of normally dry areas as a result of increased water levels in an established water course. The flood warning normally specifies crest information. It usually occurs 6 hours or later after the causative event, and it is usually associated with widespread heavy rain and/or snowmelt or ice jams.

The warning will contain the forecast point covered, the current stage (if it is available), and the established flood stage. From the forecast crest, the NWS determines which areas will be affected by the river flooding. This information is included in the warning that is issued as a site/event-specific call-to-action.

The TAC will monitor the NWS website and report any warnings to the RAC at the POD or will contact the Operations/Site Manager if an immediate threat occurs.

2.2 River Stage Reporting

Estimated Colorado River flow rates for the Cisco, Utah, gaging station (based on upstream flow rates and weather systems impacting the Colorado River basin) can be monitored on the National Oceanic and Atmospheric Administration (NOAA) website at <http://www.cbrfc.noaa.gov/river/station/flowplot/flowplot.cgi?CLRU1>. Figure 4 shows an example hydrograph from the Cisco gage.

The homepage to the Colorado Basin River Forecast Center can be found at www.cbrfc.noaa.gov.

In addition, the NOAA Western Water Supply Forecast web page, <http://wateroutlook.nwrfc.noaa.gov/point/evolution?id=CLRU1&mode=r>, provides a long-term seasonal runoff volume forecast that can be closely monitored.

3.0 Decision-making for Mitigating Potential Flood Damage

Table 1 provides a summary of the critical flows, the river surface elevation, and the areas of the site that will be impacted by flood waters as discussed in Section 1.3.

To avoid unnecessary efforts and associated costs with flood preparation, specific actions are triggered by observed river flow rates and stage forecasts for the Cisco gage. Taking the historical data into account, this Plan establishes conservative trigger points for action at 15,000 cfs, 25,000 cfs, and 35,000 cfs or greater.

These trigger points account for increases in flow rate that may occur over the weekend, when site support is reduced. Figures A-1 through A-4 in Appendix A show the ground elevation, the elevation of specific river flows, and how the site may be impacted.

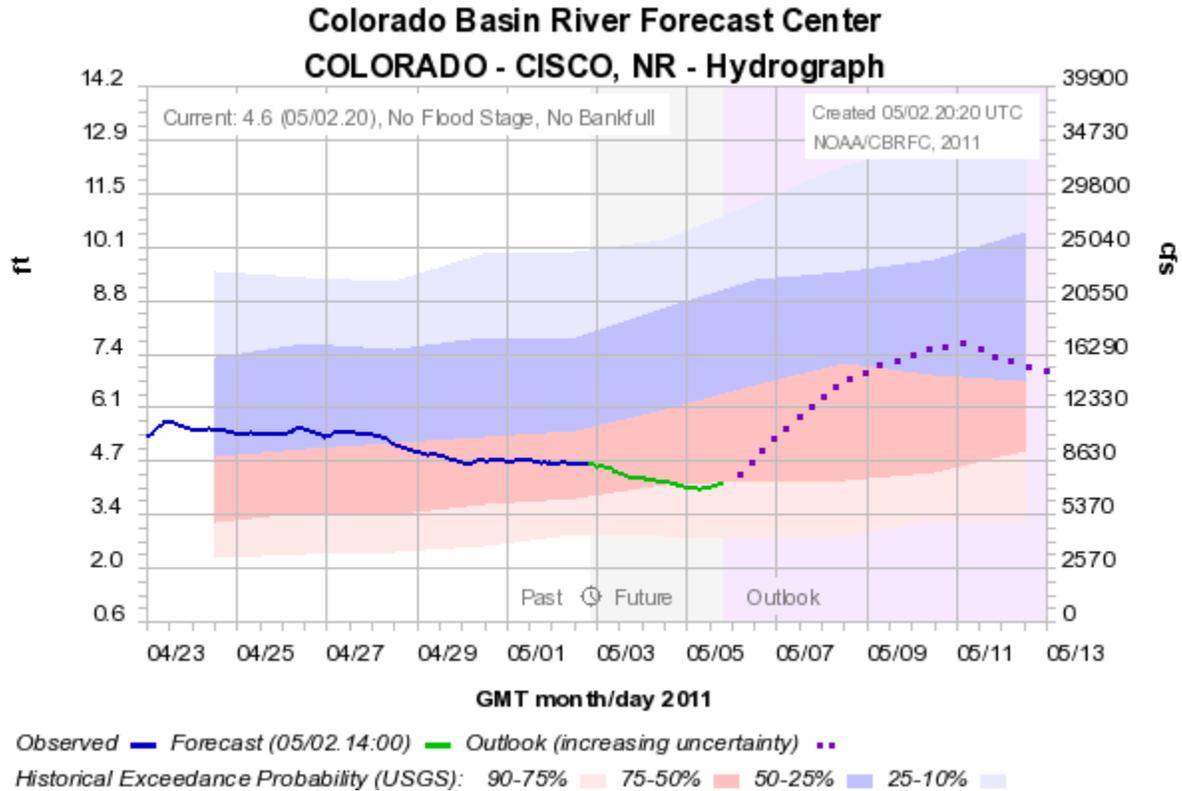


Figure 4. Example Hydrograph From Cisco, Utah, Gaging Station

Table 1. Key River Flows, River Surface Elevations, and Associated Areas Impacted

River Flow (cfs)	Elevation (ft msl)	Area Impacted
11,000	3,957	Surface water enters the surface depression just north of Moab Wash.
14,500	3,958.7	Surface water enters the northern off-pile area.
17,000	3,959.3	Ground water begins to daylight in the northern off-pile area. Surface water begins to back up into Moab Wash.
22,600	3,960.7	Northern off-pile access road is inaccessible.
28,000	3962.4	Lower Moab Wash is impassable.
34,000*	3964.5	Surface water may enter the well field drainage via the southern DOE property.
37,500	3964.7	Surface water will breach the southern berm of Moab Wash.
48,000	3,967.2	Surface water expected to breach the riverbank along the well field.
60,000	3,969	Surface water will potentially reach the toe of the tailings pile.

* In 2014, surface water did not enter the drainage until 37,200 cfs. It continued to flow in until the river dropped to 34,500 cfs. It is likely that debris had blocked the channel from the river.

3.1 Specific Actions at 15,000 cfs

The TAC will take the following actions once the Cisco gage flows are predicted to reach approximately 15,000 cfs:

- Coordinate with RAC to conduct a walkdown of areas to identify potentially vulnerable assets and establish corrective actions. Visually inspect berms, determine if site boundary signs in the northern off-pile should be removed, and repair or enhance as needed.
- Determine if the head gate located off the Highway 279 well field access road should be closed.
- Shut down all freshwater injection into the well field when the river flow reaches 15,000 cfs.
- Verify all riverbed well point and observation well caps have been installed.
- Suspend irrigation activities in the northern off-pile area (as necessary) and remove irrigation equipment that may be damaged or transported out of the area by flood waters.
- Ground Water personnel will notify TAC and RAC Moab Operations/Site Manager (or RAC On-call Manager, during non-working hours), who will then notify RAC and the TAC Technical Group/Field Manager, the DOE Facility Representative, the Federal Project Director, and TAC Public Affairs.

The RAC will take the following action in other areas of the site once flows are predicted to reach 15,000 cfs.

- Inform site security and site personnel during daily safety briefing of flood-prone areas at the site where operations will be restricted for that day.

3.2 Specific Actions at 25,000 to 30,000 cfs

At flows of just above 25,000 cfs, well field access will be impacted by surface water backing up into the Moab Wash and onto the lower wash crossing. Once the Colorado River flows are predicted to reach 25,000 cfs at the Cisco gage, the TAC will perform the following tasks:

- Complete berm inspections for erosion and signs of breaching (see Attachment A).
- Secure the content of the ground water shed and associated items.
- Remove any equipment that can be damaged by rising water and relocate to higher ground.
- Check the power poles near the Moab Wash to determine if additional support is needed.
- Shut down the well field access road across the Moab Wash when deemed unsafe (historically occurs at flows greater than 25,000 cfs). The well field southern access road is typically accessible at flows of 30,000+ cfs.

If the flow is expected to exceed 30,000 cfs at the Cisco gage, the TAC will perform the following tasks. Completion of these action items will be determined at the time of the river forecast observation.

- Shut down all power to the well field and secure power following the *Moab UMTRA Project Lockout/Tagout Hazardous Energy Control Procedure* (DOE-EM/GJ1552) to prevent inadvertent energization to the well field.
- Notify an electrician to schedule CFs 1, 3, and 4 transformer removal from the well field and variable frequency drive (VFD) and electrical disconnect removal from CF5.
- Record all individual extraction/injection well flow meter values. Label and remove each well head flow meter display plate.
- Remove the pump house in the south off-pile from the well field to the lay-down area east of the office trailers.

- Measure water levels at each monitoring well equipped with a data logger/pressure transducer.
- Label, download, and remove each data logger/pressure transducer.
- Open the head gate at the Highway 279 well field access road.

The RAC will take the following actions in other areas of the site at the 25,000 cfs level flow:

- Remove all RAC and TAC equipment stored in low-lying areas and transport it to areas of the site that will not be impacted by higher flow rates.
- Remove Radiological Control air sampling station near Moab Wash (at discretion of Radiological Control personnel).

The RAC will take the following actions in other areas of the site at a level flow of approximately 30,000 cfs:

- Remove air monitoring equipment from the well field.

3.3 Specific Actions at 35,000 cfs or Greater

For flows that are predicted to reach 35,000 cfs or greater, the TAC will perform the following tasks:

- Hold weekly (or more frequently as needed) meetings to discuss site actions and predicted river flow forecasts.
- Contact Williams Northwest Pipeline at 435-220-0139 to inform them that we are expecting a flow of greater than 35,000 cfs, so they will have time to remove electrical equipment from their equipment located adjacent to the river intake structure.
- Contact Enterprise to inform them that we are expecting a flow of greater than 40,000 cfs.
- If the river reaches an elevation not encountered before, actions will be taken as warranted by the site conditions.

The RAC will take the following actions in other areas of the site at the 35,000 cfs level flow:

- Close the river intake pump head gate to avoid sediment from accumulating inside structure.
- Determine if signage is necessary to warn boaters about underwater hazards on the site.

3.4 Specific Actions for Moab Wash during Heavy Precipitation Events

In the event of heavy rainfall events that produce visible flow in the Moab Wash, the TAC will:

- Take photos of the wash flow (if the storm event occurs during work hours).
- Close off access to lower crossing until flow stops, and any sediment is scanned, cleaned, or removed.
- Close the upper wash crossing while the wash is flowing; employees in the Support Area/Queue will have to enter and exit the site off of State Route 279 until deemed safe by Safety, Health, and Quality. A blue light will be used at the Guard Shack to indicate that the upper Moab Wash crossing is impassible.

4.0 Specific Actions for Flood Mitigation

Representatives of the RAC and TAC will jointly observe the Colorado River bank and lower portion of the Moab Wash and associated berms to identify low points, erosional features, or loose soils that may be subject to further erosion during flooding.

Objects that may be disrupted during flooding will be noted to determine if relocation or protection in place is preferred. The representatives pay attention to possible hazardous materials (see list with security guards at the site entry kiosk) that may require special actions. The walkdown survey may result in corrective actions; any potential impacts/issues will be discussed with RAC Operations/Site Managers, and appropriate actions will be taken.

5.0 Specific Actions after Flood Water Recedes

Once the well field is accessible and there is no longer a threat of flooding or danger, the TAC will perform the following tasks:

- Assess any flood damage on the river berm and in the well field. Complete any necessary corrective actions.
- Contact the electricians to re-install the VFDs on the CF5 wells and the transformers in CFs 1, 3, and 4.
- Return flow meter face plates to all of the wells.
- Return data loggers/pressure transducers to wells.
- Identify areas of standing water and determine whether mosquito abatement is necessary.
- Remove the lockout/tagout on the well field power.
- Resume well field extraction.
- Resume well field injection after the river flow drops to less than 15,000 cfs.
- Conduct a post-flood meeting to discuss sediment removal from the Moab Wash lower crossing or other areas of the site and the repair of roads and berms.

The RAC will complete the following actions after the flood water has receded, and the area adjacent to the river is deemed safe:

- Radiologically scan the areas that flood for any potential contamination.
- Return air-monitoring stations to the well field.

6.0 References

DOE (U.S. Department of Energy) *Moab UMTRA Project Emergency/Incident Response Plan* (DOE-EM/GJ1520).

DOE (U.S. Department of Energy) *Moab UMTRA Project 2011 Flood Response Summary* (DOE-EM/GJTAC2007).

DOE (U.S. Department of Energy) *Moab UMTRA Project Lockout/Tagout Hazardous Energy Control Procedure* (DOE-EM/GJ1552).

Federal Emergency Management Agency, "Flood Insurance Study, Grand County, Utah," 2006.

National Oceanic and Atmospheric Administration at <http://www.cbrfc.noaa.gov/river/station/flowplot/flowplot.cgi?CLRU1>

National Oceanic and Atmospheric Administration Western Water Supply Forecast at <http://wateroutlook.nwrfc.noaa.gov/point/evolution?id=CLRU1&mode=r>

U.S. Geological Survey Scientific Investigations Report 2005-5022, "Initial Phase Investigation of Multi-Dimensional Streamflow Simulations in the Colorado River, Moab Valley, Grand County, Utah," 2004.

Appendix A.
Surface Water Elevation vs. Site Elevation

Appendix A. Surface Water Elevation vs. Site Elevation



Figure A-1. Potential Impact of 15,000 cfs

Appendix A. Surface Water Elevation vs. Site Elevation (continued)

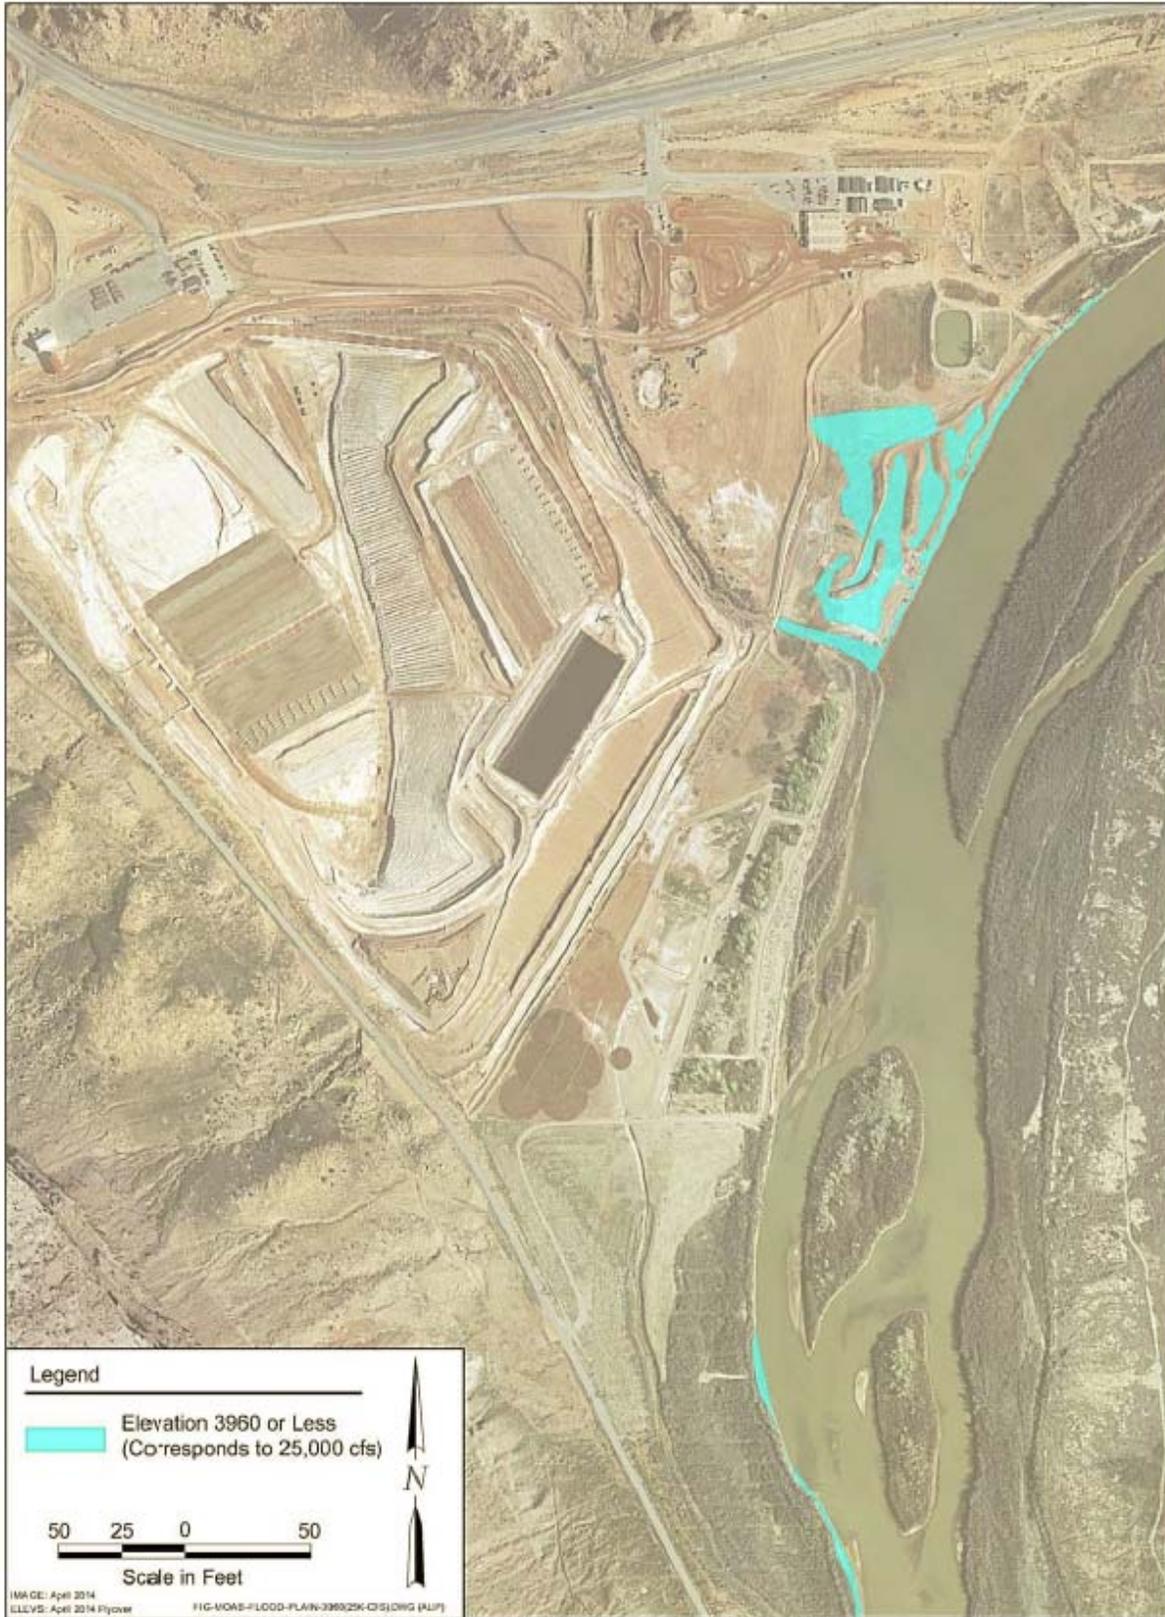


Figure A-2. Potential Impact of 25,000 cfs

Appendix A. Surface Water Elevation vs. Site Elevation (continued)

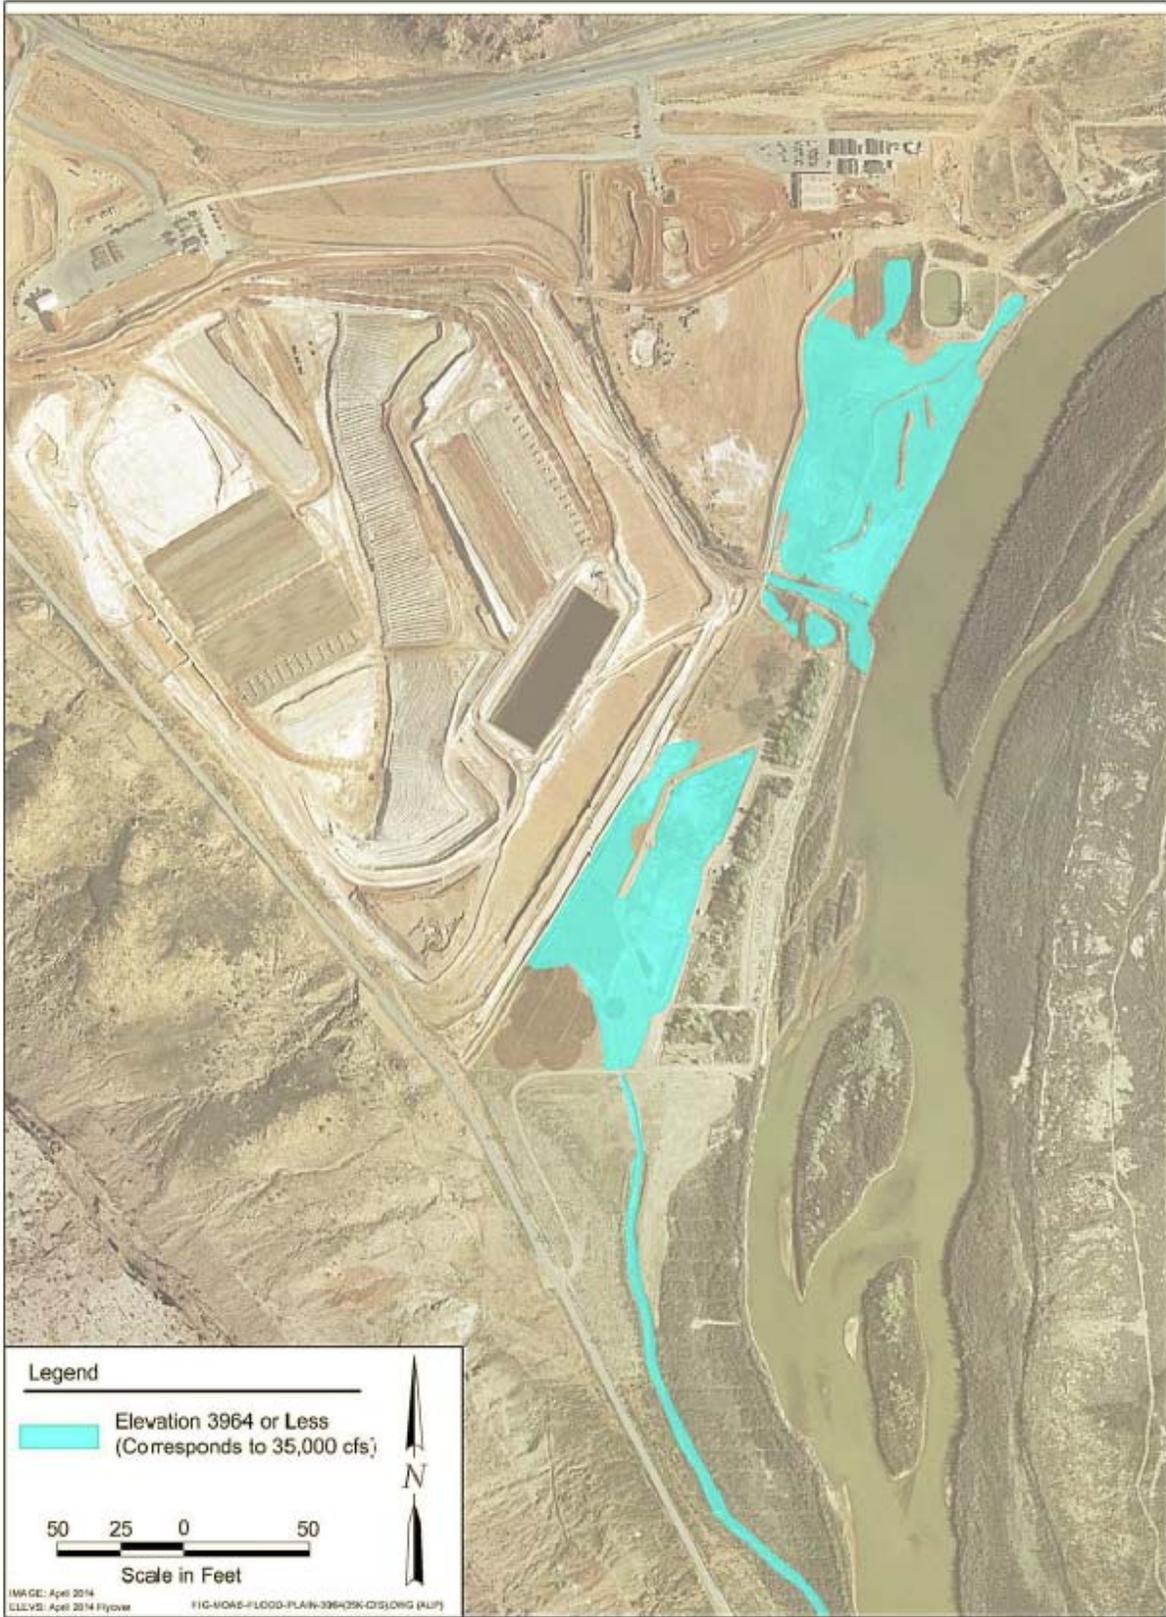


Figure A-3. Potential Impact of 35,000 cfs

Appendix A. Surface Water Elevation vs. Site Elevation (continued)



Figure A-4. Potential Impact of 40,000 cfs

Attachment 1.
Berm Inspection Form and Checklist

Attachment 1. Berm Inspection Form and Checklist



Berm Inspection Form and Checklist

INFORMATION:

Inspection Date: _____
Inspection Time: _____
Name of Inspector: _____
Weather Condition: _____
River Flow (cfs): _____

OBSERVATIONS:

- Bank Caving** (*most failure occurs on river-ward slope*)

- Cracking Parallel to Riverbank**

- Slope Slumping/Bulging**

- Soil Erosion**

- Surface Water Seepage** (*wet areas on the berm*)

- Animal Burrows**

WERE PHOTOS TAKEN?

Yes No

DEFICIENCIES REPORTED TO:

ADDITIONAL NOTES:

Attachment 1. Berm Inspection Form and Checklist (*continued*)

